

CLASS TEST

GATE
exclusive

S.No. : 03 GH1_ME_GT_250719

Casting & Welding



MADE EASY

India's Best Institute for IES, GATE & PSUs

Delhi | Noida | Bhopal | Hyderabad | Jaipur | Lucknow | Indore | Pune | Bhubaneswar | Kolkata | Patna

Web: www.madeeasy.in | E-mail: info@madeeasy.in | Ph: 011-45124612

CLASS TEST 2019-2020

MECHANICAL ENGINEERING

Date of Test : 25/07/2019

ANSWER KEY ➤ Casting & Welding

- | | | | | |
|--------|---------|---------|---------|---------|
| 1. (b) | 7. (b) | 13. (d) | 19. (b) | 25. (b) |
| 2. (c) | 8. (d) | 14. (d) | 20. (c) | 26. (d) |
| 3. (b) | 9. (a) | 15. (a) | 21. (a) | 27. (d) |
| 4. (c) | 10. (d) | 16. (c) | 22. (a) | 28. (c) |
| 5. (d) | 11. (c) | 17. (b) | 23. (d) | 29. (b) |
| 6. (c) | 12. (d) | 18. (a) | 24. (a) | 30. (d) |

DETAILED EXPLANATIONS

5. (d)

The hot chamber process is used for most of the low melting temperature alloys, such as zinc, lead and tin.

6. (c)

Strength of the part after compaction is called green strength.

7. (b)

Converging passages or sprues are provided to avoid aspiration effect. Air entrapped due to aspiration causes blow holes in castings.

9. (a)

Gating ratio is ratio of cross-sectional area of sprue : runner : gates

10. (d)

Converging passages are used as spures to gain in velocity of molten metal as it reduces airaspiration.

12. (d)

Hot chamber die casting is suitable to cast materials which has low melting point. This method is used to cast the alloys of lead, tin and zinc.

This method can also be used for casting Aluminium alloys because the material has a tendency to pick up some iron due to extended contact with the casting equipment.

14. (d)

Surface area of cube = $6l^2$

Surface area of sphere = $4\pi r^2$

According to Chorinov's relation

$$\text{Solidification time} \propto \left(\frac{\text{volume}}{\text{surface area}} \right)^2$$

as volume of cube and sphere are equal

$$\frac{t_c}{t_s} = \left(\frac{A_s}{A_c} \right)^2 = \left(\frac{4\pi r^2}{6l^2} \right)^2$$

$$\frac{t_c}{t_s} = \left(\frac{4\pi}{6} \right)^2 \left(\frac{r}{l} \right)^4$$


16. (c)

$$V = L B t$$

$$A = 2 [LB + Lt + Bt]$$

$$\frac{V}{A} = \frac{L B t}{2 [LB + Lt + bt]}$$

$$\frac{V}{A} = \frac{1}{2 \left[\frac{1}{t} + \frac{1}{B} + \frac{1}{L} \right]}$$

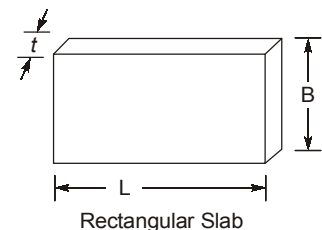

for slab, $L \gg t$ and $B \gg t$,

$$\therefore \frac{V}{A} = \frac{t}{2}$$

Solidification time,

$$T \propto \left(\frac{V}{A}\right)^2$$

$$\therefore \frac{T_1}{T_2} = \left(\frac{t_1}{t_2}\right)^2$$

or

$$t_2 = t_1 \sqrt{\frac{T_2}{T_1}} = 3 \sqrt{\frac{4}{2}} = 4.2426 \text{ cm}$$

20. (c)

$$t = k \left(\frac{V}{A}\right)^2$$

$$\frac{t_1}{t_2} = \left(\frac{V_1}{A_2} \times \frac{A_2}{V_2}\right)^2 = \left\{ \left(\frac{d_1}{6}\right) \left(\frac{6}{d_2}\right) \right\}^2$$

$$\frac{t_1}{t_2} = \left(\frac{d_1}{d_2}\right)^2$$

$$\frac{10}{t_2} = \left(\frac{2}{4}\right)^2 = t_2 = 10 \times 4 = 40 \text{ sec}$$

21. (a)

$$\text{Bottom gate, } t_A = \frac{2A}{A_g \sqrt{2g}} [\sqrt{h_m} - \sqrt{h_m - H}] = 20 \text{ min.}$$

where,

$A \rightarrow$ area of mould

$A_g =$ area of gate

$H = h_m$

According to question,

$$\Rightarrow t_A = \frac{2A}{A_g \sqrt{2g}} \sqrt{h_m} = 20$$

For top gate,

$H = h_m$

$$\Rightarrow t_B = \frac{A \sqrt{h_m}}{A_g \sqrt{2g}} = \frac{t_A}{2} = 10 \text{ min}$$

22. (a)

$$d = 200 \text{ mm}$$

 \therefore

$$r = 100 \text{ mm} = 0.1 \text{ m}$$

$$\text{Solidification time} = k \left(\frac{V}{A} \right)^2$$

$$1078 = k \left(\frac{\frac{4}{3} \times \pi \times (0.1)^3}{4 \times \pi \times (0.1)^2} \right)$$

$$k = 1078 \times \frac{9}{(0.1)^2} = 0.97 \times 10^6 \text{ s/m}^2$$

23. (d)

Aluminium, wax and mercury can be used for making patterns.

■■■■